











**I. G. LEVY MEMORIAL PARK
 PLAY AREA
 3900 CHICOT ST.**

TRANSITION PLAN

ITEM #	SECTION #: GROUP	NON-COMPLIANCE DESCRIPTION	COMMENTS / SUGGESTED CORRECTIONS	PRIORITY	COST CODE	BUDGET COST	COMPL. DATE	PHOTOGRAPHS
1	502: Parking Spaces (Park wide)	<ol style="list-style-type: none"> 1. Accessible parking signage missing. 2. No van spaces. 3. Striping faded. 4. Curb ramps running slope exceeds 1:12. 5. Curb ramps encroach upon sidewalk (head of parking spaces) clear width. 	<ol style="list-style-type: none"> 1. Locate (2) accessible spaces near playground restroom, (1) being van accessible, with signage. 2. Locate (1) accessible space near playground, with signage. 3. Re-stripe accessible parking and aisles. 4. Remove and replace sidewalk 	1	PK1 AA1 PS CR3	\$ 9,000	Completed per Darcie Crew	
2	403: Walking Surface	<ol style="list-style-type: none"> 1. No accessible route between parking, playground and restrooms. 2. Changes in level exceed 1/4". 3. Running slope exceeds 1:12. 4. Cross slope exceeds 1:48. 	<ol style="list-style-type: none"> 1. Remove and replace 5' sidewalk from parking, playground and restrooms. (±150 L.F.) 2. Provide accessible route signage. 	2	SW3 SW4	\$ 7,500		
3	206: Accessible Route	<ol style="list-style-type: none"> 1. No sidewalks to pavilions or adjacent grill. 	<ol style="list-style-type: none"> 1. Provide 45 L.F. of 4' walks to pavilion and grills. (±45 L.F.) 2. Provide accessible route signage. 	2	SW2	\$ 2,000		
4	206: Accessible Route	<ol style="list-style-type: none"> 1. Cross slope exceeds 1:48 between playgrounds. 2. Changes in level > 1/4" between handicap parking and playground. 	<ol style="list-style-type: none"> 1. Replace 50 S.F. walk between play sets. 	2	SW2	\$ 750		
5	602: Drinking Fountain	<ol style="list-style-type: none"> 1. No protection from restroom door. 	<ol style="list-style-type: none"> 1. Provide a guard rail or door stop to protect user from impact of opening door. 	4	EDF1	\$ 2,000		
6	1008: Play Areas (Tree House)	<ol style="list-style-type: none"> 1. First and second ramp slopes are too steep. 2. No handrails. 	<ol style="list-style-type: none"> 1. Adjust ramps. 2. Provide dual handrails at 36" and 26" above ramp. 	2	R3 HR1	\$ 1,000		

**I. G. LEVY MEMORIAL PARK
 PLAY AREA
 3900 CHICOT ST.**

TRANSITION PLAN

ITEM #	SECTION #: GROUP	NON-COMPLIANCE DESCRIPTION	COMMENTS / SUGGESTED CORRECTIONS	PRIORITY	COST CODE	BUDGET COST	COMPL. DATE	PHOTOGRAPHS
7	1008: Play Areas (ship)	<ol style="list-style-type: none"> 1. First ramp slope is too steep. 2. No handrails. 	<ol style="list-style-type: none"> 1. Correct ramp slope. 2. Provide dual handrails at 36" and 26" above ramp. 	2	R2 HR1	\$ 1,000		
8	903: Benches	<ol style="list-style-type: none"> 1. No accessible sitting space besides benches. 	<ol style="list-style-type: none"> 1. Recommendation to provide stable access to 20% of benches. 2. Recommendation to provide accessible space (±3'x3') beside bench for bench access or wheelchair parking beside bench. 	2	BCH	\$ 500		
9	404: Doors, Doorways & Gates	<ol style="list-style-type: none"> 1. Force to open doors is > 5 lbs. 2. Door closes too fast. 	<ol style="list-style-type: none"> 1. Adjust door closures. 	2	OL	\$ 250		
10	604: Water Closets & Toilet Compartments	<ol style="list-style-type: none"> 1. Men's does not have required 5'-0" turning diameter. 2. Mirrors in men's and women's mounted above required 40". 3. Push type sink faucet hard to press. 	<ol style="list-style-type: none"> 1. Adjust partition location to provide 5' turning space. 2. Lower mirrors. 3. Adjust or replace faucet with ADA compatible unit. 	3	TLT1	\$ 1,100		

REPORT TOTAL: \$ 25,100